



the future is safer with altro

altro  
transflor

# Altro Transflor Suprema™ II



Earth TFSUI2066  
WR282 / A1M239 / LRV 23



Cocoa TFSUI2060  
WR62 / A1M62 / LRV 10




Lava TFSUI2070  
WR260 / A1M260 / LRV 8



Vine TFSUI2035  
WR233 / A1M233 / LRV 20




Meadow TFSUI2072  
WR233 / A1M233 / LRV 21

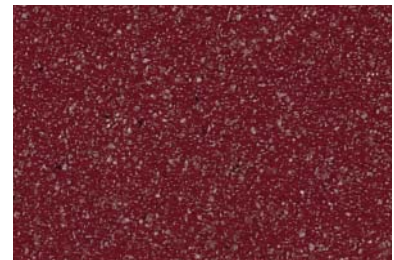

Poppy TFSUI2045  
WR280 / A1M238 / LRV 10



Caspian TFSUI2038  
WR194 / A1M71 / LRV 18

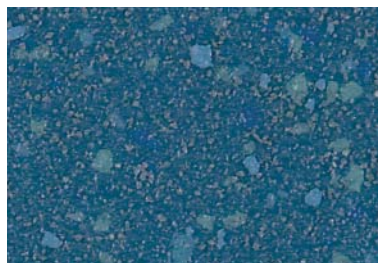

Bluewater TFSUI2073  
WR194 / A1M71 / LRV 17




Platinum TFSUI2064  
WR201 / A1M84 / LRV 24



Flint TFSUI2034  
WR82 / A1M82 / LRV 13



Fossil TFSUI2067  
WR232 / A1M82 / LRV 12

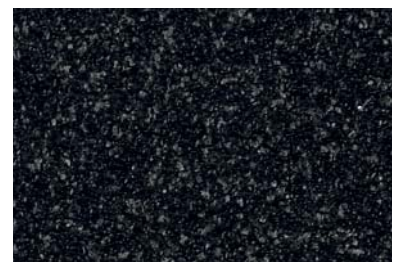

















Raven TFSUI2054  
WR277 / A1M100 / LRV 7

Light Reflectance Values measured in accordance with BS8493:2008

Exact Material Match with samples cannot be guaranteed.  
No podemos garantizar que el material del suelo de seguridad coincida exactamente con el de las muestras.  
Eine exakte Übereinstimmung des Materials mit Mustern kann nicht garantiert werden.



Flooring Type Tipo de pavimento Belagsart		EN 13845/ EN 13553	Safety flooring Suelo de seguridad antideslizante Sicherheitsbodenbelag
Slip Resistance Resistencia al deslizamiento Rutschsicherheit		TRRL EN 13845 EN 13893 DIN 51130	≥ 36 ESf DS R10
Thickness Espesor Total Gesamtdicke		EN 428	2 mm
Wear Layer Capa de uso Nutzschicht		EN 429	0.8 mm
Flexibility Flexibilidad Flexibilität		EN 435	Pass Conforme Bestanden
Weight Peso Flaechengewicht		EN 430	2.6 kg/m <sup>2</sup>
Roll Dimensions Dimensiones del rollo Rollenabmessungen		EN 426	2.0m x 20.00m - 40m <sup>2</sup>
Light Fastness Resistencia a la luz Lichtechtheit		EN 20105-B02	≥6
Sound Insulation Aislamiento acústico Trittschal		ISO 140-8	5 dB
Wear Resistance Abrasión Verschleißverhalten		EN 13845	≤10% particles lost over 50000 Cycles ≤10% de las partículas perdidas en 50.000 ciclos ≤10% Partikel werden über 50000 Umdrehungen verloren
Indentation Punzonamiento Resteindruck		EN 433	≤ 0.10mm
Fire Performance Reacción al fuego Brandverhalten		EN ISO 9239-1 EC 95/28	≥8kW/m <sup>2</sup> Pass, Conforme, Bestanden
Chemical Resistance* Resistencia a los productos químicos* Chemikalieneinwirkung*		EN 423	Good Buena Beständig
Castor Chair Abrasion Huellas de sillas de ruedas Stuhlrollenbeanspruchung		EN 425	Pass Conforme Geeignet
Under floor heating Calefacción por el suelo Fußbodenheizung		EN 12667	Suitable Apto Geeignet
Electrical Behaviours Características eléctricas Elektrisches Verhalten		EN 1815	≤ 2kV Antistatic ≤ 2kV Antiestáticas ≤ 2kV antistatisch

\* Caution Ketone/Aromatic Solvents. Please contact Altro for further technical advice regarding staining and chemical resistance.

### Installation and Maintenance

All installations in accordance with local standards and Altro Transflor installation instructions. Joints all heat welded. Subfloor and adhesives as recommended in Altro Transflor installation instructions or visit [www.altrotransflor.com](http://www.altrotransflor.com).

Note: Failure to install and maintain Altro flooring in accordance with 'Altro Transflor installation instructions' can affect its performance and slip resistance. Floors should be protected from other trades and thoroughly cleaned before handover. Altro Transflor are not recommended for areas where lighted cigarette ends are likely to be left or trodden into the floor.

All information is correct at the time of print and is subject to change without prior notice.

Visit us at [www.altrotransflor.com](http://www.altrotransflor.com) for more information and updates.



Altro Limited a company certified by SGS to ISO 9001 and ISO 14001.

**Altro Limited, [www.altrotransflor.com](http://www.altrotransflor.com), Altro GmbH, e-mail: [welcome@altro.de](mailto:welcome@altro.de), Altro Nordic AB, e-mail: [info@altro.se](mailto:info@altro.se),  
Altro Transflor - USA, [www.altrotransflor.com](http://www.altrotransflor.com), Altro Transflor - Canada, [www.altrotransflor.com](http://www.altrotransflor.com),  
Altro Australia, [www.asf.com.au](http://www.asf.com.au), Altro China, [www.altrochina.com](http://www.altrochina.com)**